

**Flood Control Project Maintenance  
Levee Inspections**

## Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2018

### Plumas County

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 North Fork Feather River	Left	1.89	09/19/2018 09/19/2018	Bob Duffey

LM Start		Rating **	A	Issue No.	1
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Operations & Maintenance Manuals			°	°
DWR ID	DWR_NA0015_01_s_2013_1				
Comment Code					
Inspector Comment					
The LMA has O&M manuals.					

No Photos

LM Start		Rating **	A	Issue No.	2
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Emergency Supplies & Equipment			°	°
DWR ID	DWR_NA0015_01_s_2013_2				
Comment Code					
Inspector Comment					
The LMA has flood fight supplies and equipment.					

No Photos

LM Start		Rating **	M	Issue No.	3
LM End		Issue Type +	Ma	Location *	N/A
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Flood Preparedness & Training			°	°
DWR ID	DWR_NA0015_01_s_2013_3				
Comment Code					
Inspector Comment					
The LMA has not completed flood flight training in the last ten years.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

# Plumas County

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2018**

**Plumas County**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 01 North Fork Feather River	Left	1.89	09/19/2018 09/19/2018	Bob Duffey

LM Start	0.68	Rating **	M	Issue No.	4
LM End	0.68	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Encroachments			40.281480 °	40.281480 °
				-121.250928 °	-121.250928 °
DWR ID	DWR_NA0015_01_s_2013_4				
Comment Code					
PR : Prunings					
Inspector Comment					

Photo 1 of 1 : FA\_2018\_NA0015\_337\_4\_20180905\_00001.jpg



View of the prunings along the landside slope.

LM Start	0.79	Rating **	M	Issue No.	18
LM End	1.88	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			40.282962 °	40.297068 °
				-121.251307 °	-121.257120 °
DWR ID	DWR_NA0015_01_s_2018_18				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the small pine trees and vegetation from the landside slope.					

Photo 1 of 1 : FA\_2018\_NA0015\_337\_18\_20180905\_00009.jpg



View of the small pine trees and vegetation along the landside slope.

LM Start	0.79	Rating **	M	Issue No.	19
LM End	1.88	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			40.282962 °	40.297068 °
				-121.251307 °	-121.257120 °
DWR ID	DWR_NA0015_01_s_2018_19				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the small pine trees and vegetation from the waterside slope.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---





**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2018**

**Plumas County**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 North Fork Feather River	Right	1.36	09/19/2018 09/19/2018	Bob Duffey

LM Start	0.00	Rating **	M	Issue No.	2
LM End	0.71	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			40.286462 °	40.279948 °
				-121.260082 °	-121.252118 °
DWR ID	DWR_NA0015_02_f_2017_2				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the small pine trees and vegetation from the landside slope.					

Photo 1 of 1 : FA\_2018\_NA0015\_338\_2\_20180905\_00001.jpg



View of the small pine trees and vegetation along the landside slope.

LM Start	0.00	Rating **	M	Issue No.	3
LM End	0.71	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			40.286462 °	40.279948 °
				-121.260082 °	-121.252118 °
DWR ID	DWR_NA0015_02_f_2017_3				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Remove the small pine trees and vegetation from the waterside slope.					

Photo 1 of 1 : FA\_2018\_NA0015\_338\_3\_20180905\_00002.jpg



View other small pine trees and vegetation along the waterside slope.

LM Start	0.46	Rating **	C	Issue No.	6
LM End	0.46	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			40.283059 °	40.283059 °
				-121.253989 °	-121.253989 °
DWR ID	DWR_NA0015_02_f_2013_6				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
The vehicle erosion was repaired along the waterside slope.					

No Photos

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	N : Not Inspected/Rated C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	---	---

**Flood Control Project Maintenance  
Levee Inspections**

**Maintenance Issue Types Only, Levee Inspection Report By Mile - Fall 2018**

**Plumas County**

Waterway	Bank	Unit Miles	Inspection Start/End	Inspector
Unit No. 02 North Fork Feather River	Right	1.36	09/19/2018 09/19/2018	Bob Duffey

LM Start	0.55	Rating **	M	Issue No.	4
LM End	0.55	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			40.281950°	121.253710°
				40.281950°	121.253710°
DWR ID	DWR_NA0015_02_s_2012_4				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
The vehicle erosion was repaired along the landside slope.					

Photo 1 of 1 : FA\_2018\_NA0015\_338\_4\_20181001\_00013.jpg



View of the repaired vehicle erosion along the landside slope.

LM Start	0.55	Rating **	M	Issue No.	5
LM End	0.55	Issue Type +	Ma	Location *	WS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Slope Stability			40.281950 °	121.253710 °
				40.281950 °	121.253710 °
DWR ID	DWR_NA0015_02_s_2012_5				
Comment Code					
S3 : Repair the levee slope damaged by vehicle traffic and prevent access where possible.					
Inspector Comment					
Repair the vehicle erosion along the waterside slope.					

Photo 1 of 1 : FA\_2018\_NA0015\_338\_5\_20181001\_00012.jpg



View of the vehicle erosion along the waterside slope.

LM Start	0.71	Rating **	A	Issue No.	7
LM End	1.36	Issue Type +	Ma	Location *	LS
Category	Earthen Levee			GPS Latitude/Longitude	
				Start	End
Item	Vegetation			40.279948 °	40.271748 °
				-121.252118 °	-121.246737 °
DWR ID	DWR_NA0015_02_s_2018_7				
Comment Code					
V2 : Remove the wild growth other than native grasses from the levee slopes.					
Inspector Comment					
Small pine trees were removed from the landside slope.					

Photo 1 of 1 : FA\_2018\_NA0015\_338\_7\_20180905\_00007.jpg



View of the removed small pine trees from the landside slope.

<b>* Location</b> LS : Land Side    N/A : Not Applicable WS : Water Side CR : Crown	<b>** Rating</b> A : Acceptable M : Minimally Acceptable U : Unacceptable	<b>N : Not Inspected/Rated</b> C : Corrected A/W : Acceptable but Monitor & Maintain	<b>+ Issue Type</b> Ma : Maintenance Deficiency Ob : Design & System Obsolescence En : Enforcement
--	--	--	---